


Accent (BN7i) Infotainment Unit – Software Update Guide

1. Identify your System Type and appropriate Software:
 - a. Switch ON your Car's Infotainment Unit
 - b. Go to Settings > Other > System Version
 - c. Refer to the Image below and check your unit's System Type. If your Unit's System Type is "AV_6255W" then proceed else please Exit the Software Update Guide immediately, this update is not meant for your Unit.
 - d. Refer to the Software Code and note the correct applicable update.

Software Code	Applicable Update
57	DAB System
57N	Normal System

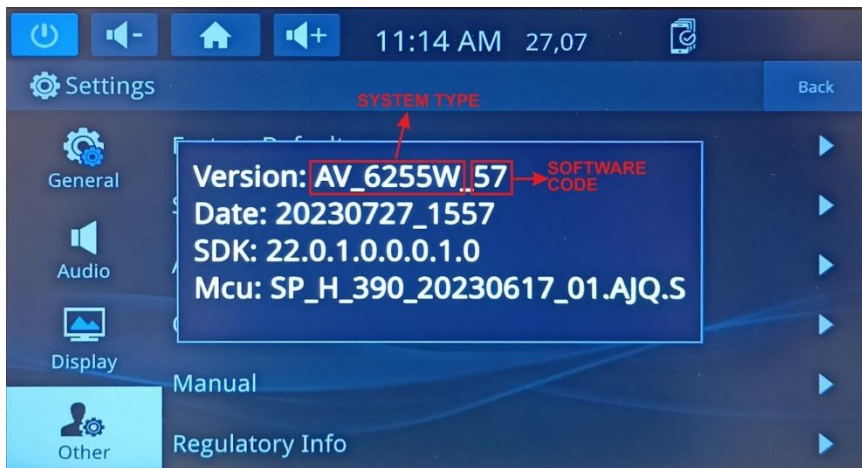


2. Check the current software version of your Unit

- a. Go to Settings > Other > System Version
- b. Check Date


Decoding Date (20230727_1557)	
2023	Year
07	Month
27	Date
15	Hour
57	Minute

c. Check MCU Version Date & Time

Decoding MCU Version (SH_H_390_20230617_01.AJQ.S)	
SP_H_390_	Internal Reference
2023	Year
06	Month
17	Date
01	Sequence
.AJQ.S	Internal Reference

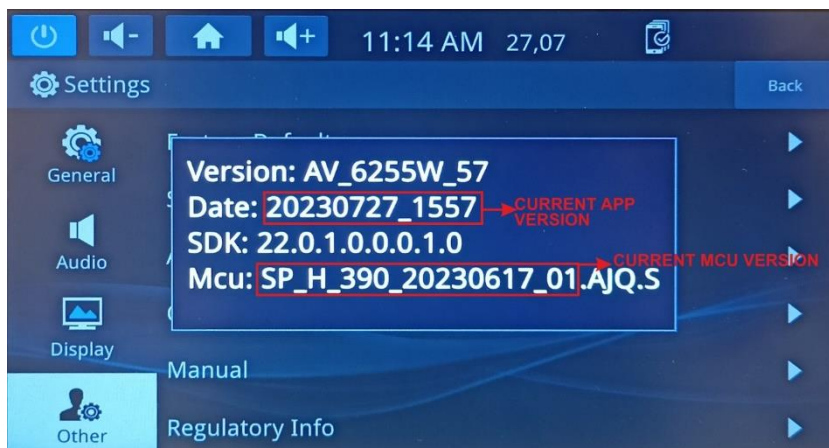


3. Visit <https://bn7isoftware.megaaudio.in/> url and check the Date & MCU Version of the latest software version applicable for your unit. If the available software version is an update to your unit's software version then download the update and follow steps below.
4. Updating the Software:
 - a. Resources required:
 - i. A Pen Drive (Capacity - minimum 4 GB maximum 128 GB)
 - ii. Computer with USB Port, Internet Connection & software for unzipping
 - b. Format the Pen Drive in FAT32 File Format
 - c. Unzip the downloaded update file and copy all the files in it, to Pen Drive's root directory
 - d. Switch on the vehicles ignition and park the vehicle, keep the vehicle parked and the engine running till the upgrade process is complete
 - e. Ensure that the infotainment unit is switched on, Insert the Pen Drive into the vehicle's USB port
 - f. You will see the upgrade dialog. Click "OK", it will automatically enter app upgrade mode. **(Figure 2)**

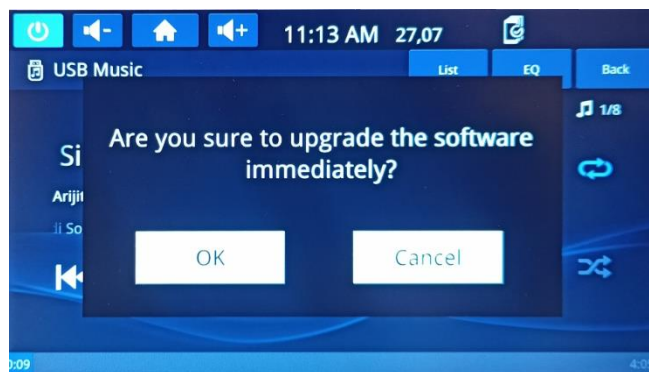


(Figure 2)

- g. You will see the screen of Upgrade in progress Note: **(Please do not switch off and unplug the U disk during upgrade)**. **(Figure 3)**

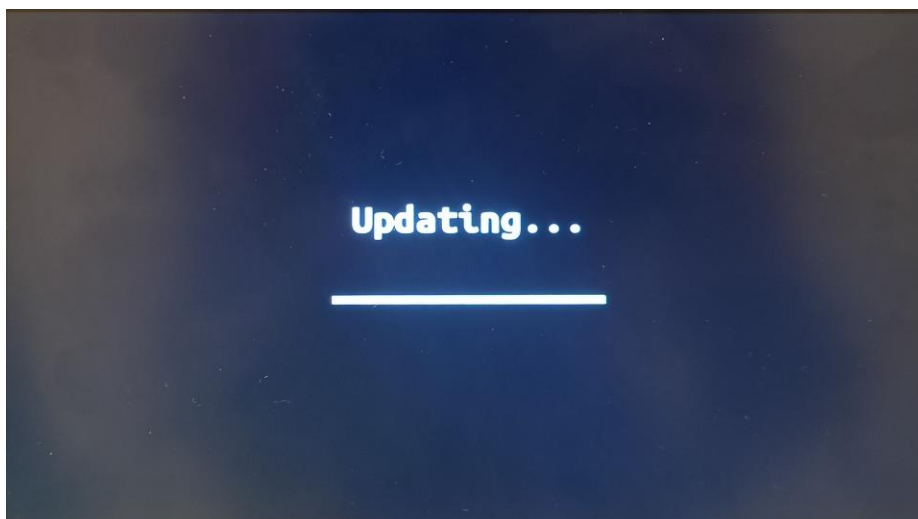


(Figure 3)

- h. After APP update completed, wait 1 min, then system will update MCU automatically. **(Figure 4)**

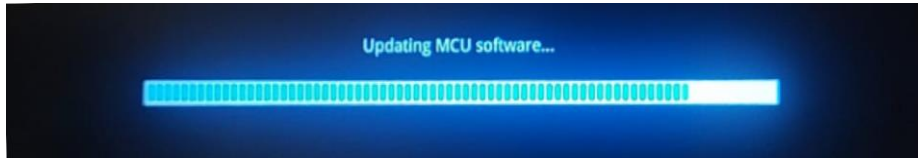

(Figure 4)

- i. When MCU update completed, screen will display information "finished! remove USB and click "OK". **(Figure 5)**

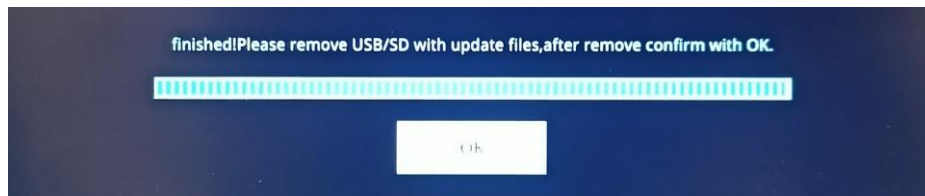

(Figure 5)

- j. After update, Go to Settings > Other > System Version and check if the software has been correctly updated.
- k. Software update process is now complete.